


| MODEL | YEAR |
|-------------------------|------------|
| All GM Models | 77-02 |
| Astro & Safari | 82-Present |
| Bravada | 91-Present |
| Buick Full Size | 77-85 |
| Camaro | 82-02 |
| Century | 78-81 |
| Chevy Full Size Car | 77-96 |
| Cutlass | 78-87 |
| El Camino | 77-87 |
| Firebird, Trans-Am, Z28 | 82-02 |
| Grand Prix | 78-87 |
| Monte Carlo | 78-87 |
| Olds Full Size | 77-89 |
| Omega | 75-79 |
| Pontiac Full Size | 77-89 |
| Phoenix | 78-81 |
| Regal | 78-87 |
| Skylark | 76-79 |
| S10, S15 (Rear) | 82-Present |
| Ventura | 78-81 |
| Isuzu Rodeo | 89-93 |

Will not fit Monza, etc.

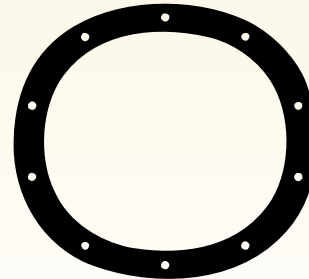

- 8-5/16" x 10-9/16"
- Oval Cover
- 10 Holes
- 10 Bolt
- 7.5" & 7.625" Diameter Ring Gear
- 1.438" Diameter Pinion
- 27 Splines

INSTALLATION KIT/HALF KIT

| PART NO. | |
|-----------|----------|
| 83-1016-1 | 77-81 |
| 83-1044-1 | 82-98 |
| 83-1016-M | 77-81 |
| 83-1044-M | 82-98 |
| 83-1044-B | Half Kit |

MINI-SPOOLS

| PART NO. | SPLINE |
|------------------------------|---------|
| • 78-7526-1 | 26 |
| Cross Shaft Pin | CSPGM75 |
| • Will not fit 7.625 carrier | |

| RATIO | PART NO. | TEETH | CARRIER |
|--------|-----------|-------|---------|
| 2.73 | 49-0048-1 | 41-15 | 2 |
| 3.08 | 49-0001-1 | 40-13 | 2 |
| 3.23 | 49-0044-1 | 42-13 | 3 |
| 3.23 | 49-0003-1 | 42-13 | 2 |
| 3.42 | 49-0045-1 | 41-12 | 3 |
| 3.42 | 49-0005-1 | 41-12 | 2 |
| 3.73 | 49-0046-1 | 41-11 | 3 |
| 3.73 | 49-0007-1 | 41-11 | 2 |
| ▲ 4.10 | 69-0322-1 | 41-10 | 3 |
| ▲ 4.10 | 49-0009-1 | 41-10 | 2 |
| ▲ 4.56 | 69-0324-1 | 41-9 | 3* |
| ▲ 4.56 | 69-0326-1 | 41-9 | 2* |

* Special Cross Pin 80-0270-1 required.
 2 Fits 3.08 and numerically lower carrier.
 3 Fits 3.23 and numerically higher carrier.
 ▲ Will not fit on Torsen differential.
 • For use in factory carrier only. Not for Mini Spool or Torsen differential.

